

LA-UR-22-31916

Approved for public release; distribution is unlimited.

Title: Electrorefining Low Yield Possible Root Causes

Author(s): Ewing, Frederic

Intended for: Report

Issued: 2022-11-10



Los Alamos National Laboratory, an affirmative action/equal opportunity employer, is operated by Triad National Security, LLC for the National Nuclear Security Administration of U.S. Department of Energy under contract 89233218CNA000001. By approving this article, the publisher recognizes that the U.S. Government retains nonexclusive, royalty-free license to publish or reproduce the published form of this contribution, or to allow others to do so, for U.S. Government purposes. Los Alamos National Laboratory requests that the publisher identify this article as work performed under the auspices of the U.S. Department of Energy. Los Alamos National Laboratory strongly supports academic freedom and a researcher's right to publish; as an institution, however, the Laboratory does not endorse the viewpoint of a publication or guarantee its technical correctness.

Electrorefining Low Yield

Possible Root Causes

Frederic Ewing, PT-1 FLM


Parts Description

(1) **Tungsten:** electrically conductive, will not oxidize significantly under applied loads (~20A, 2V), refractory metal resistant to Pu corrosion.


(2) **Magnesia Sleeve:** electrically insulates and protects electrode from electrolyte, same material as crucible, resistant to Pu/molten salt corrosion.

(3) **Paddle Tip:** electrical connection to liquid anode pool, prevents sleeve from falling off.


(4) **Dog Leg:** holds tungsten rod, sits inside furnace, passes current to tungsten, enables positioning rod within crucible cup.

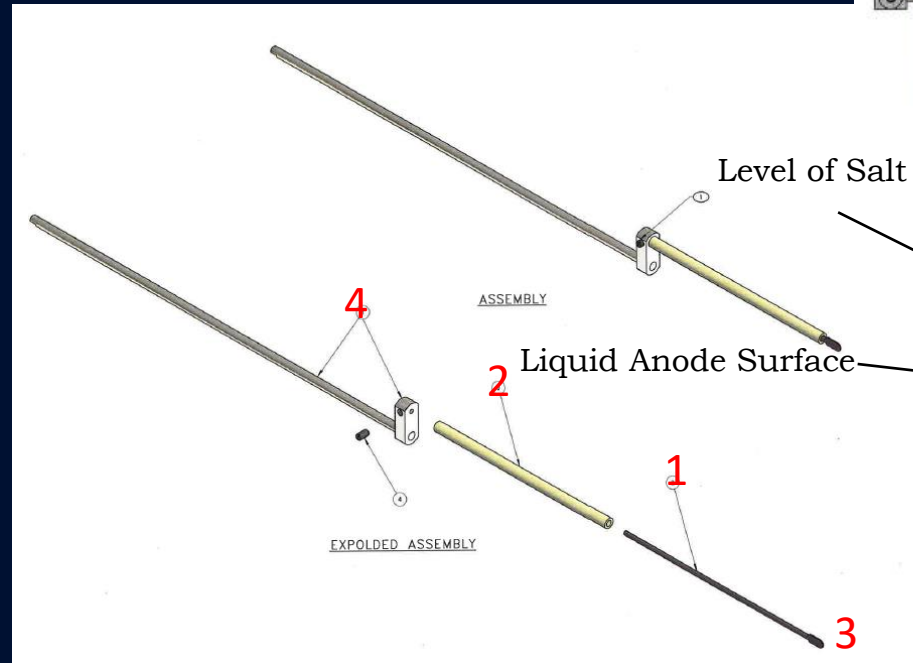


Current applied here

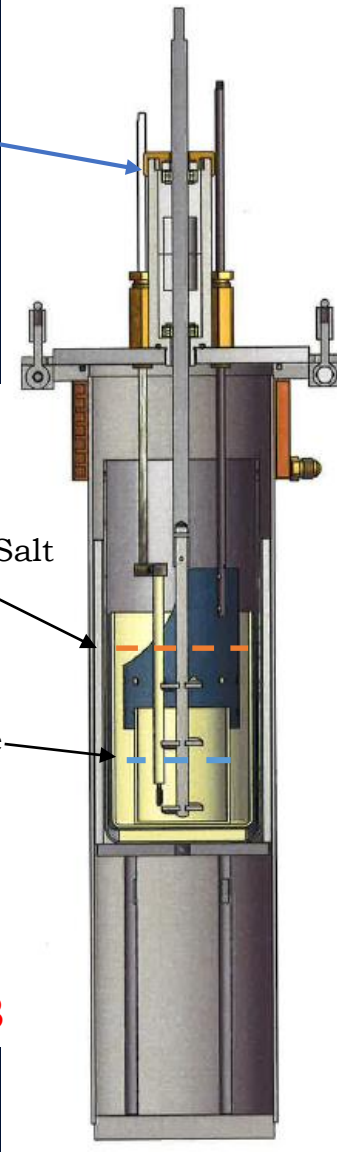


Solving the low yield problem

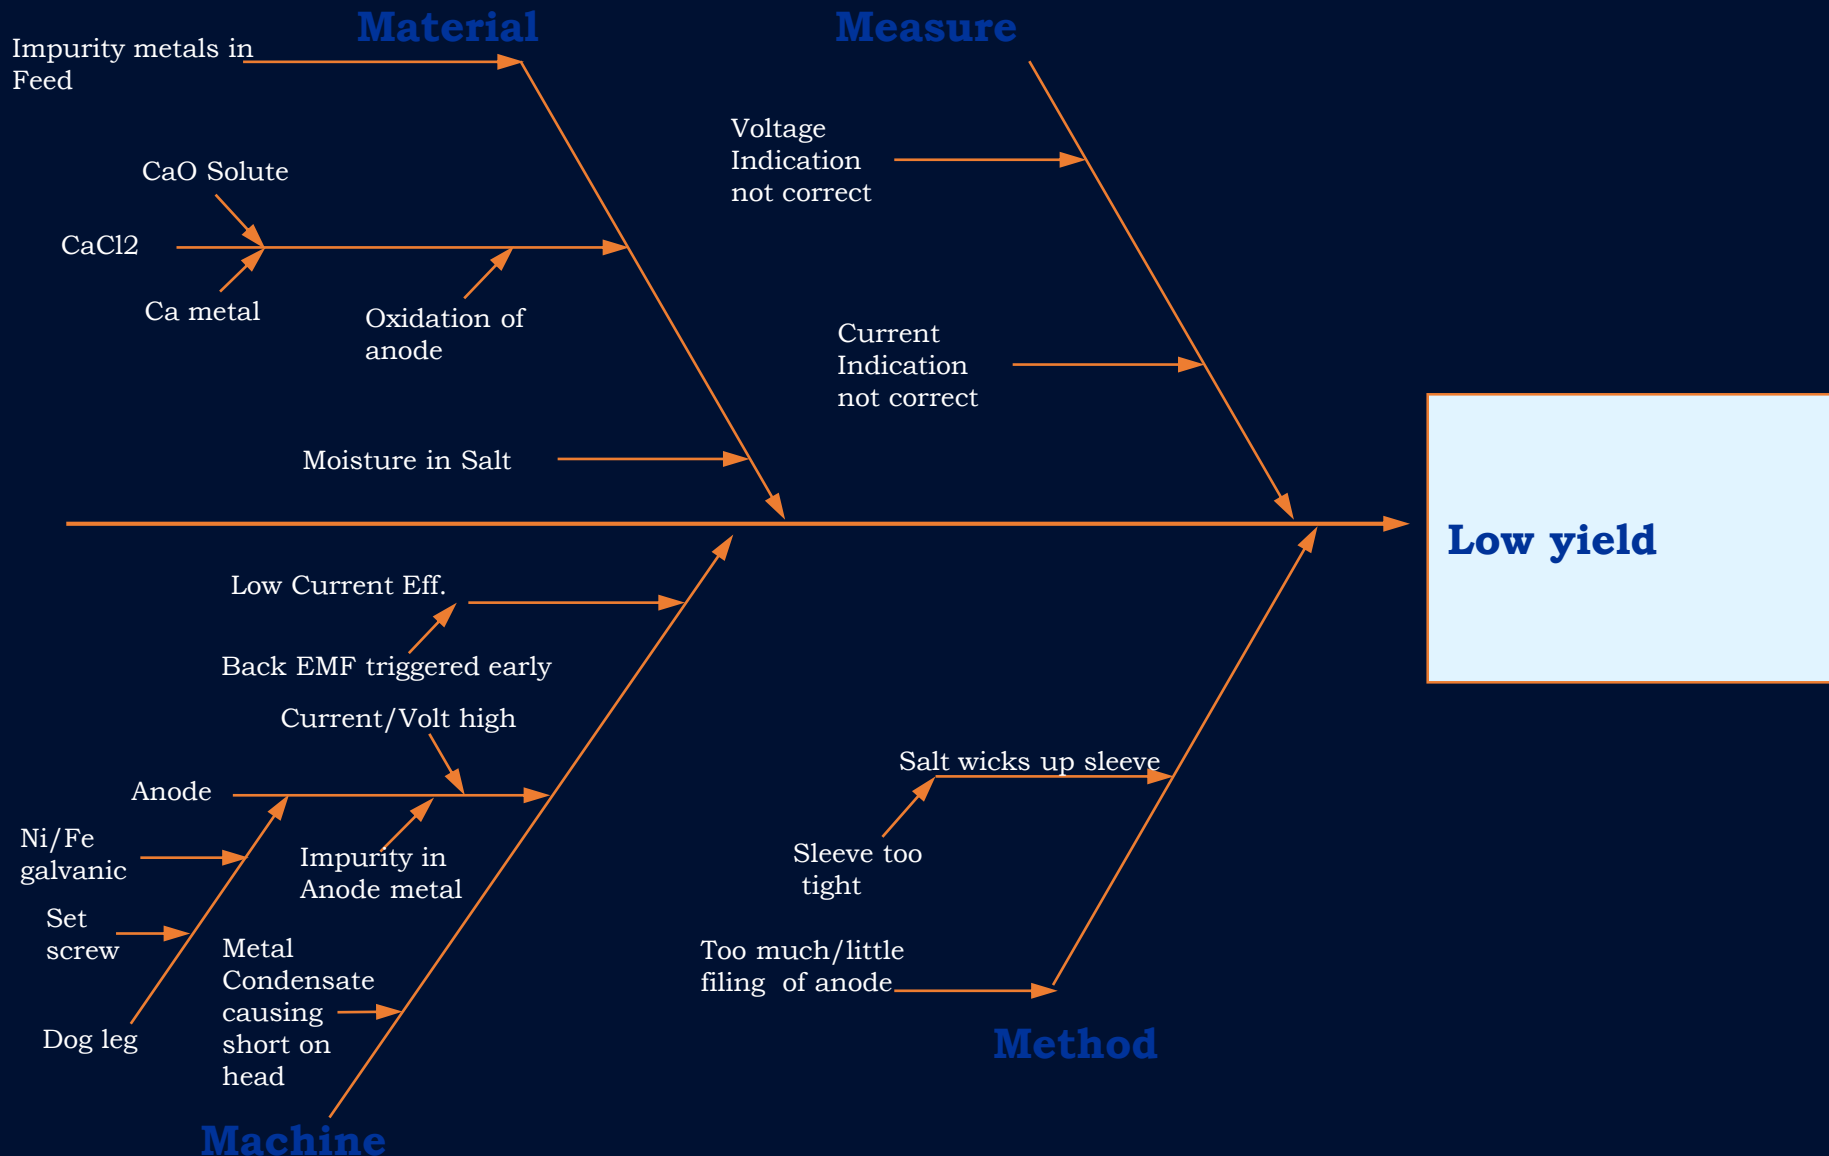


Successful Run Yields FY 20 & 21

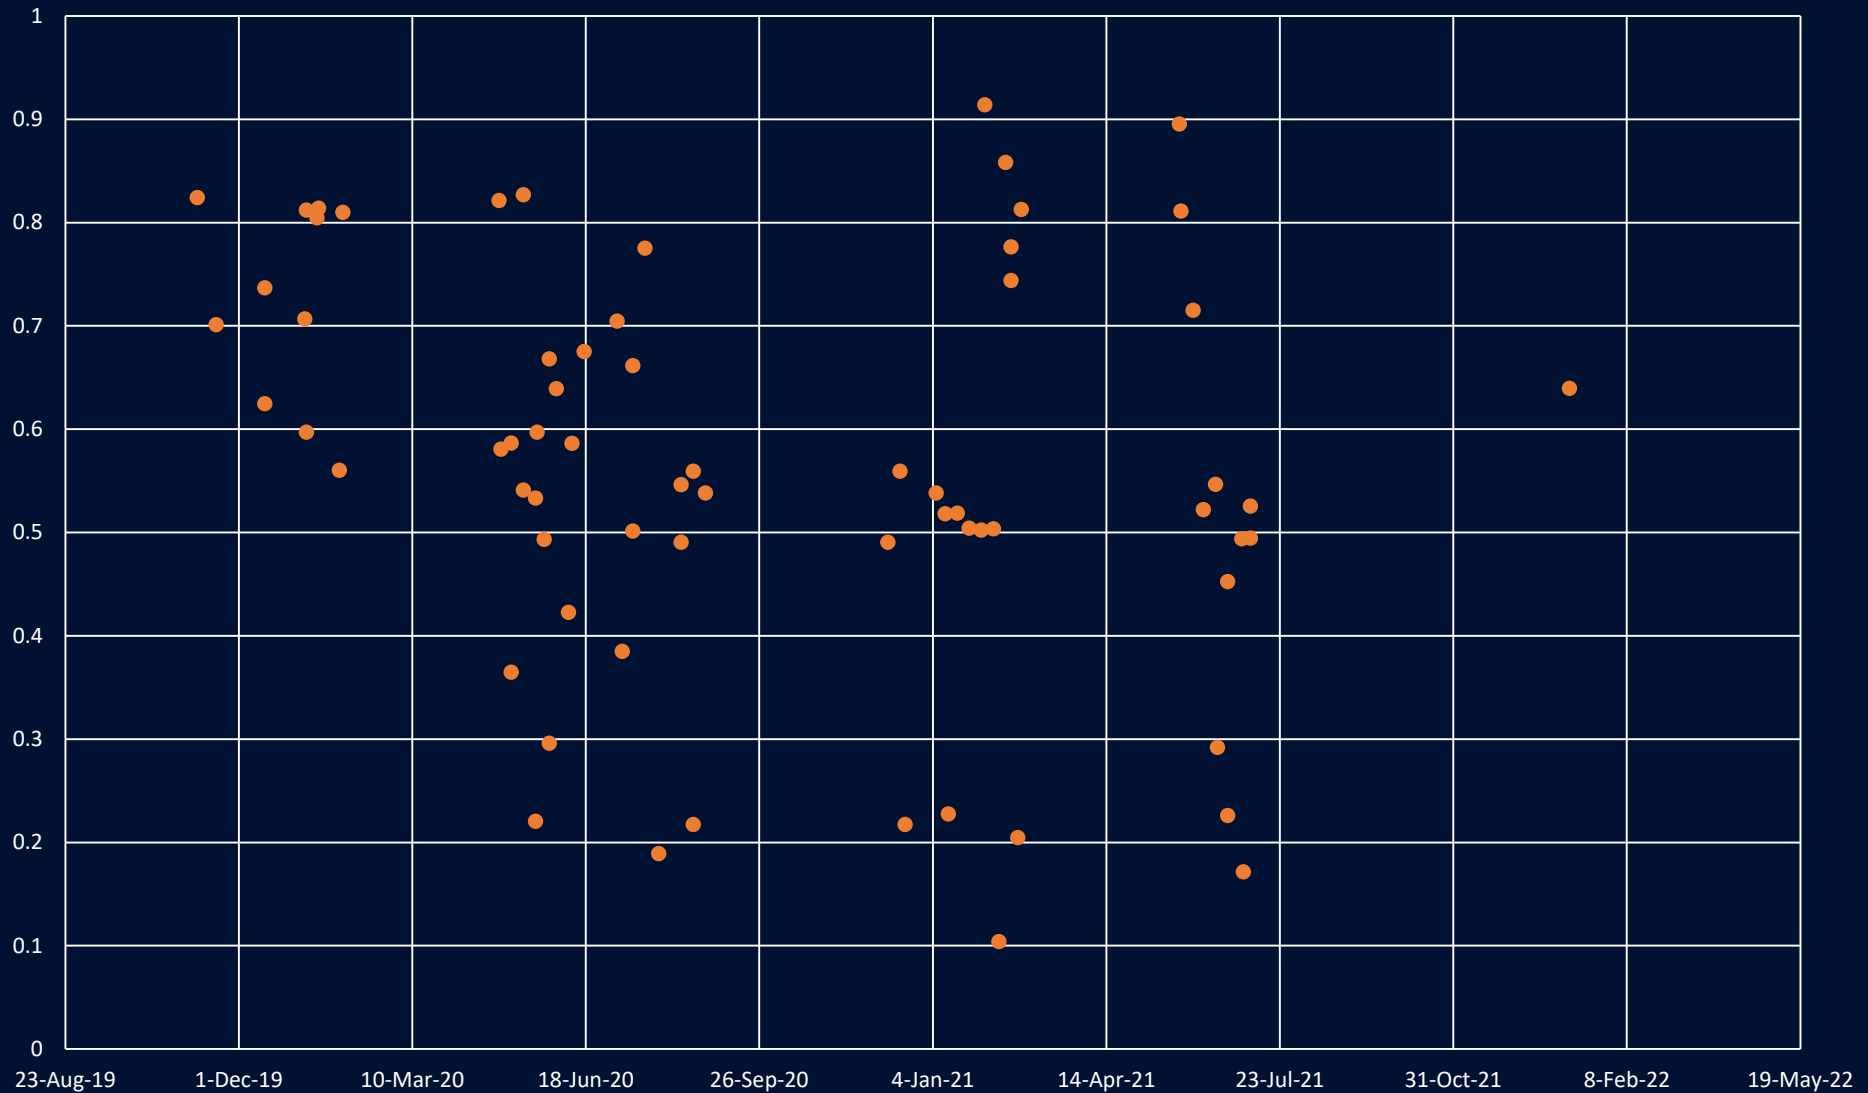


Successful Run Yields FY 20 & 21

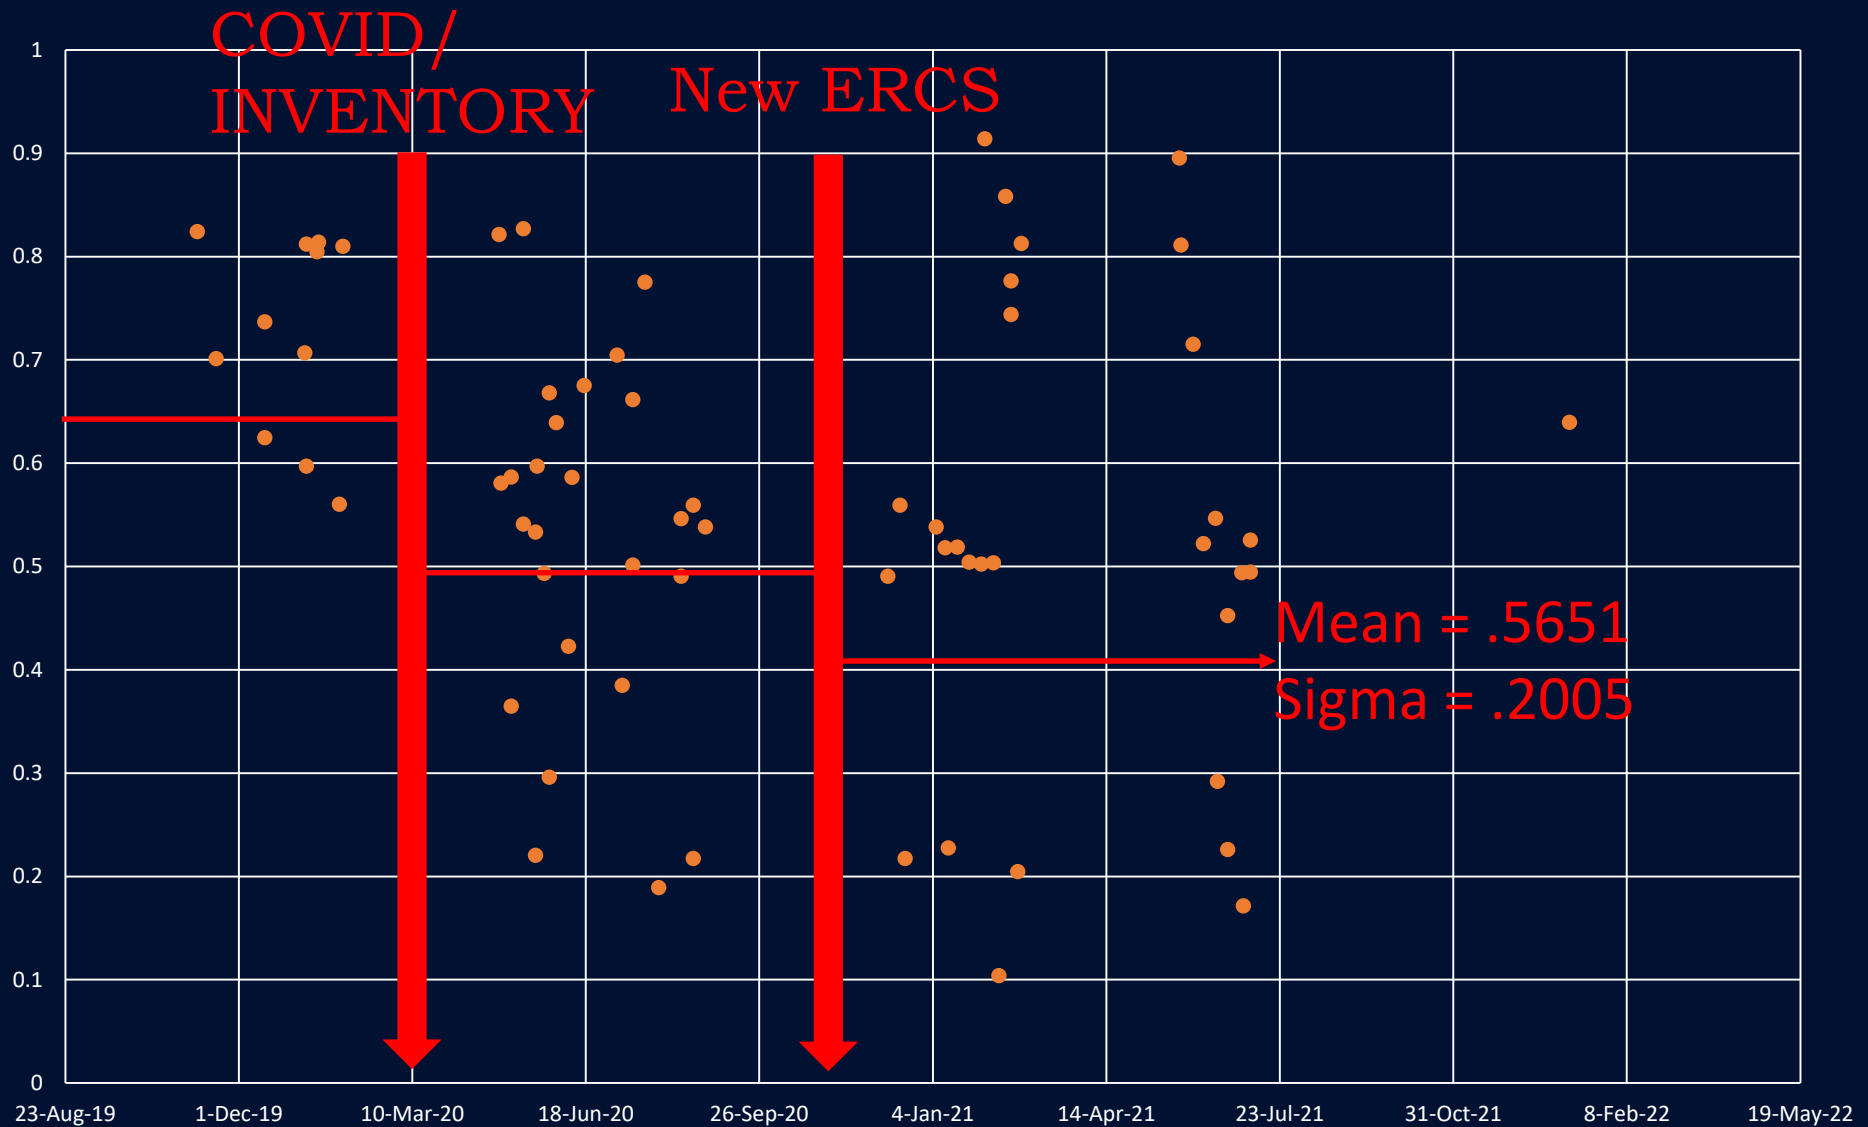

Solving the low yield problem

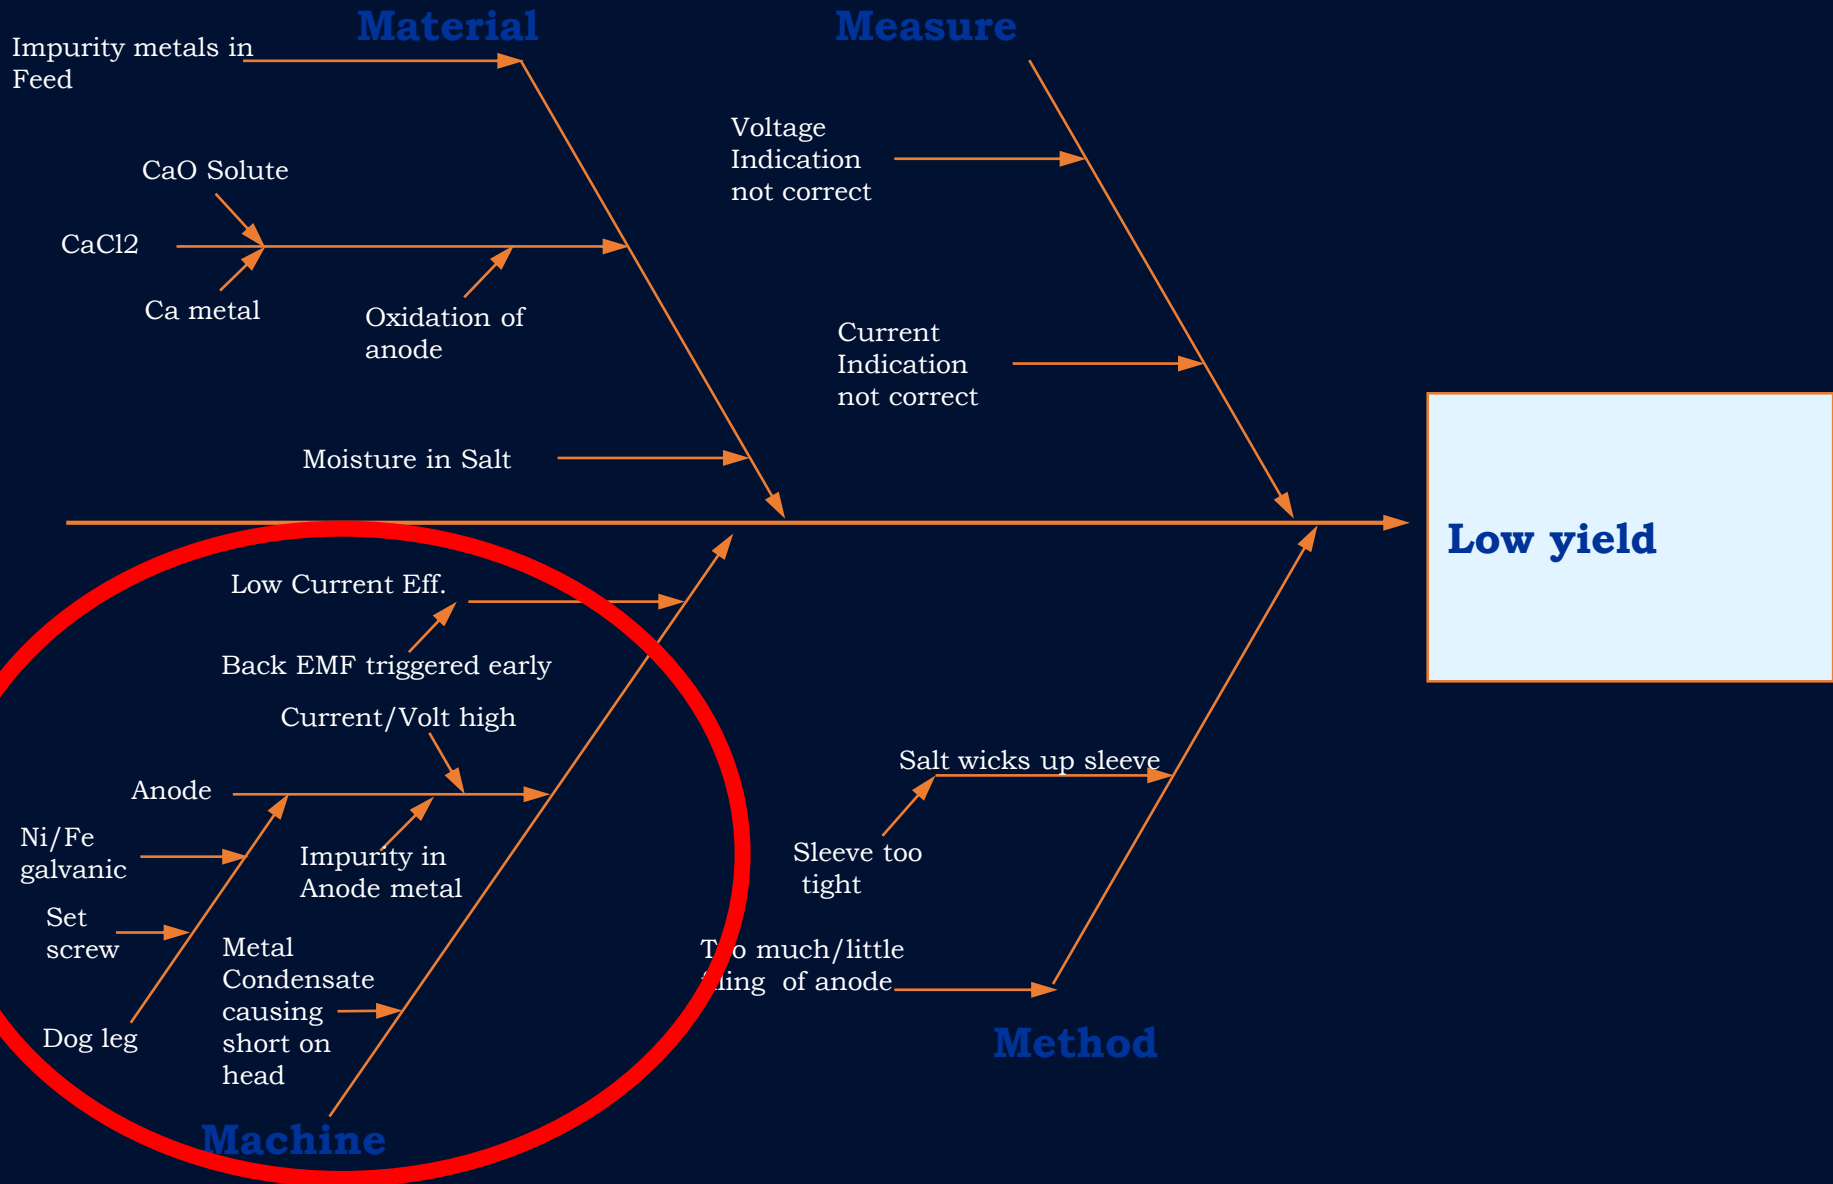

Solving the low yield problem

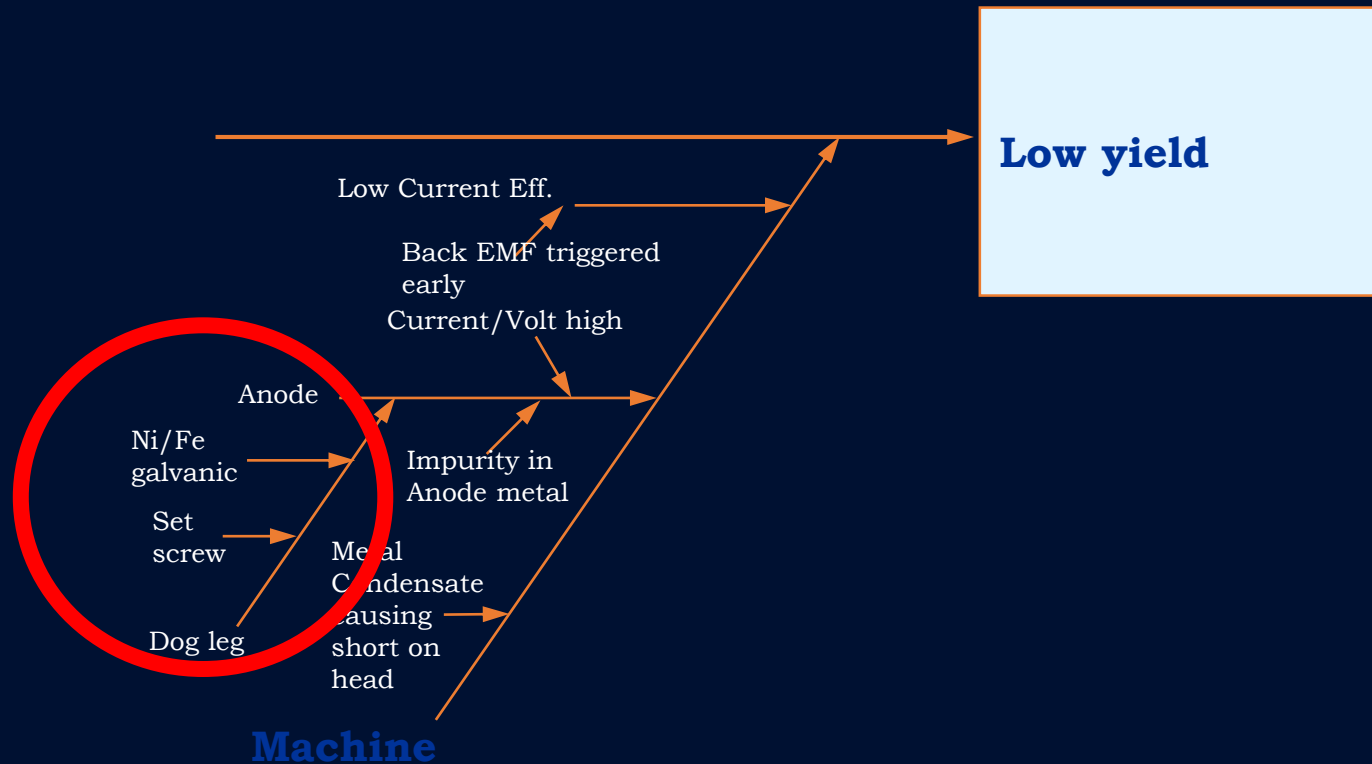

Problem #1: Paddle Falling Off

- Occurring in the majority of runs in the past 5 months.
- Electrode loses contact with the liquid anode pool, passing current directly into electrolyte, prematurely ending run.
- Sometimes, the ceramic sleeve slides off of rod when raising equipment.





Hypothesis #1

- Tungsten extraordinarily brittle.
- Very difficult to fabricate with.
- If not controlled very carefully, material properties negatively impacted (e.g., ductile to brittle transition temperature increases, grain re-crystallization)

OUR FABRICATION WAS NOT CONTROLLED WELL!

- heated with acetylene torch until “red hot”, leading to grain re-crystallization and brittleness.
- press rate for paddle not controlled, resulting in crack defects.

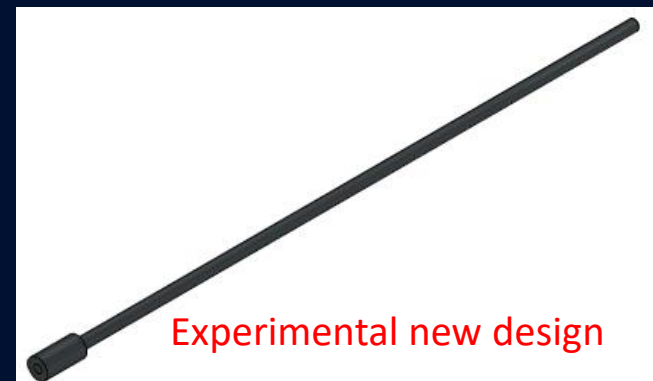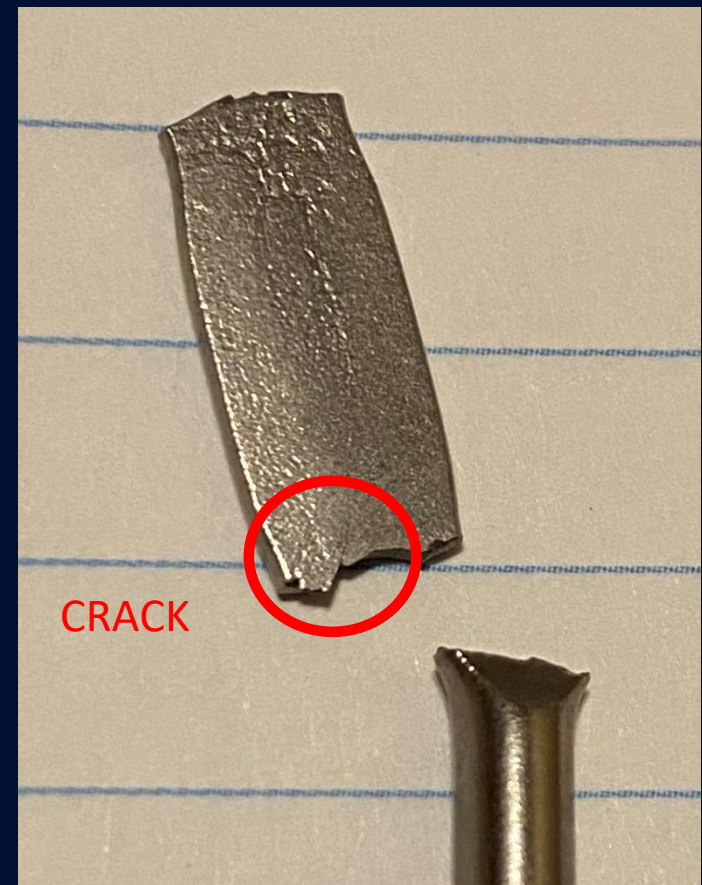


Hypothesis #2

- The anode was lowered into the melt too quickly!
- Thermal gradient induced stresses that fractured the sleeve.
- Thermal expansion coefficient of sleeve is higher than the tungsten. A gap was not left for the sleeve to expand, thus applying stress to sleeve when heated.

-
1. Change procedure to reduce insertion rate to 0.5 inches per minute (per RFP-1876), and specify 0.125-0.25" gap when assembling anode.
 2. Investigating a change from extruded magnesia, which has lower density, to different forming technique.




2021 yield failed vs good anodes

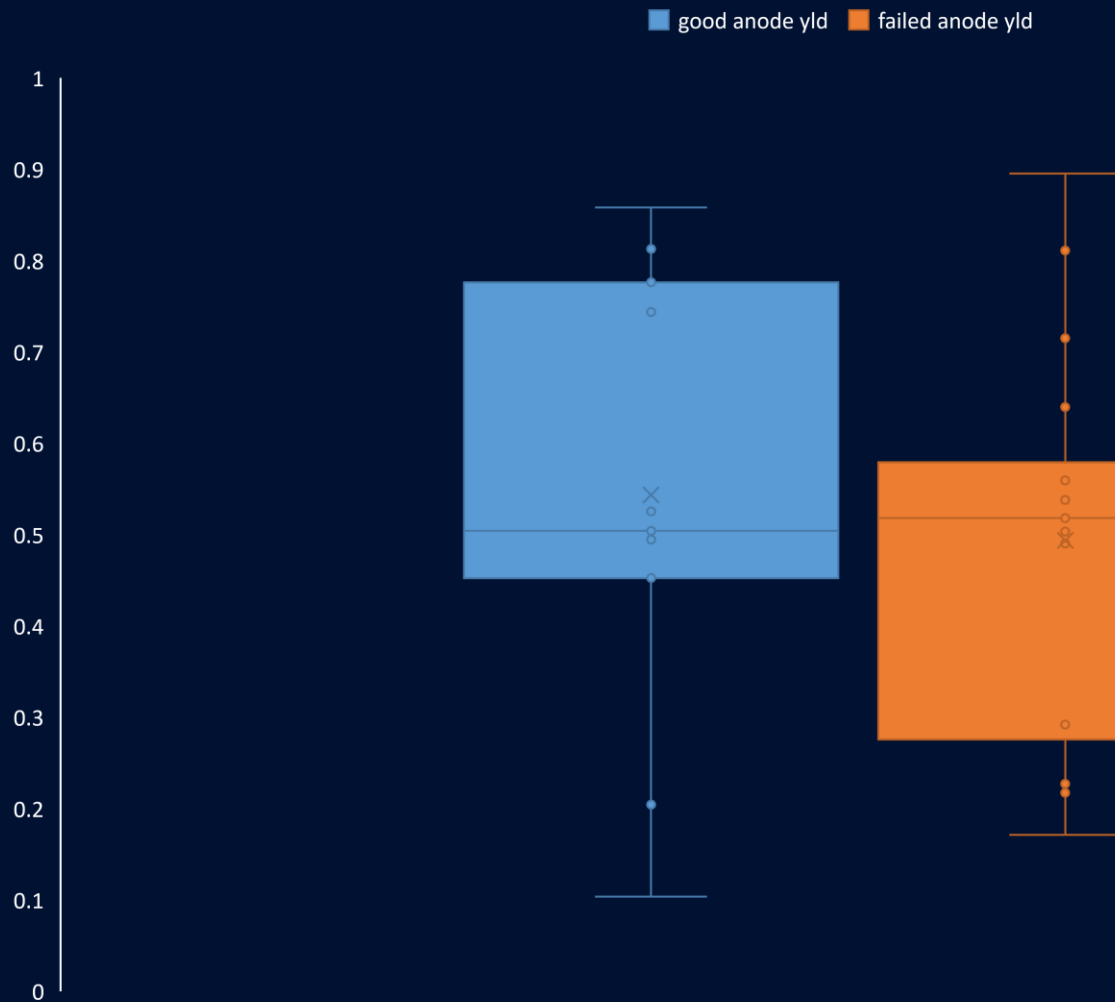

T-Tests

t-Test: Two-Sample Assuming Unequal Variances		
	good anode yld	bad anode yld
Mean	0.543413164	0.493556767
Variance	0.058828388	0.041601097
Observations	11	18
Hypothesized Mean Difference	0	
df	18	
t Stat	0.569677385	
P(T<=t) one-tail	0.287968999	
t Critical one-tail	1.734063607	
P(T<=t) two-tail	0.575937999	
t Critical two-tail	2.10092204	
t-Test: Two-Sample Assuming Equal Variances		
	good anode yld	bad anode yld
Mean	0.543413164	0.493556767
Variance	0.058828388	0.041601097
Observations	11	18
Pooled Variance	0.047981575	
Hypothesized Mean Difference	0	
df	27	
t Stat	0.594726428	
P(T<=t) one-tail	0.27848898	
t Critical one-tail	1.703288446	
P(T<=t) two-tail	0.556977959	
t Critical two-tail	2.051830516	

Solving the low yield problem

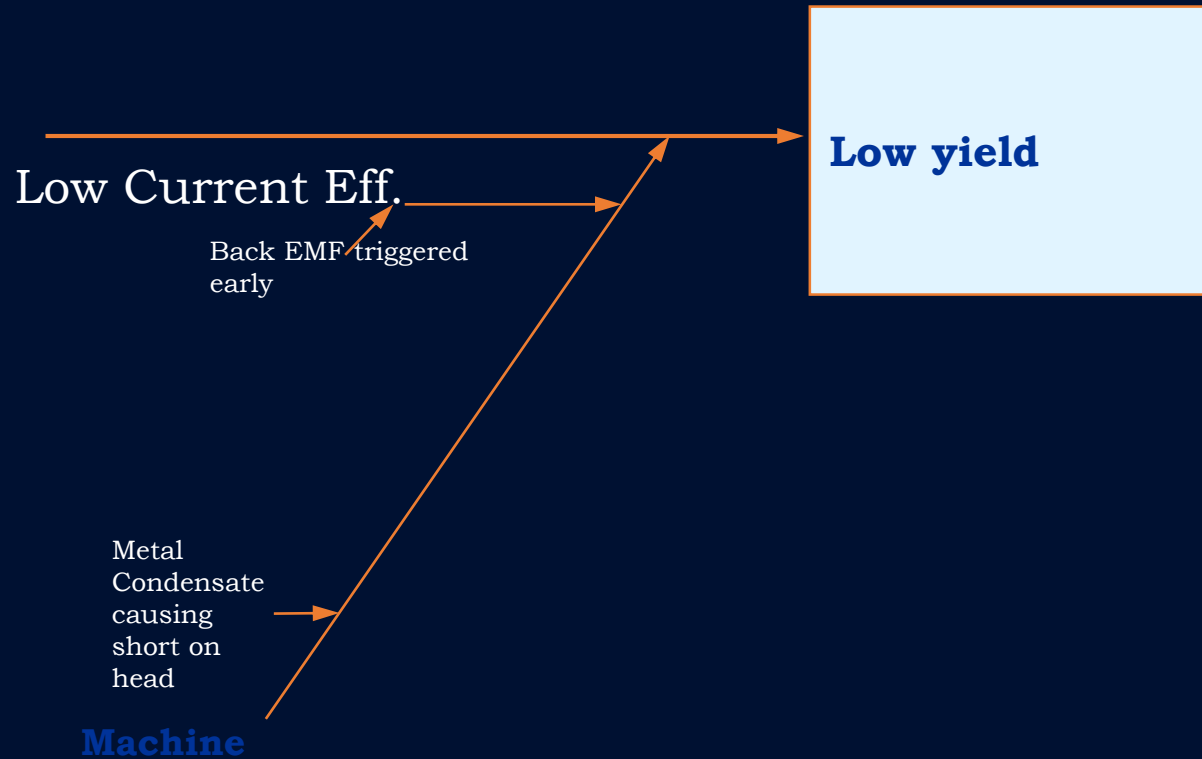

Machine

Problem


- Metal Condensate causing short on head
- Back EMF triggered early?
- Filing Anode too much

Test

- Unknown
- Raise back EMF threshold, get chemistry
- New experimental anode

Problem #3: Premature bEMF Ramp Up

-According to ERCS data, bEMF ramps up earlier in run than historical successful run, resulting in early bEMF termination of the run.

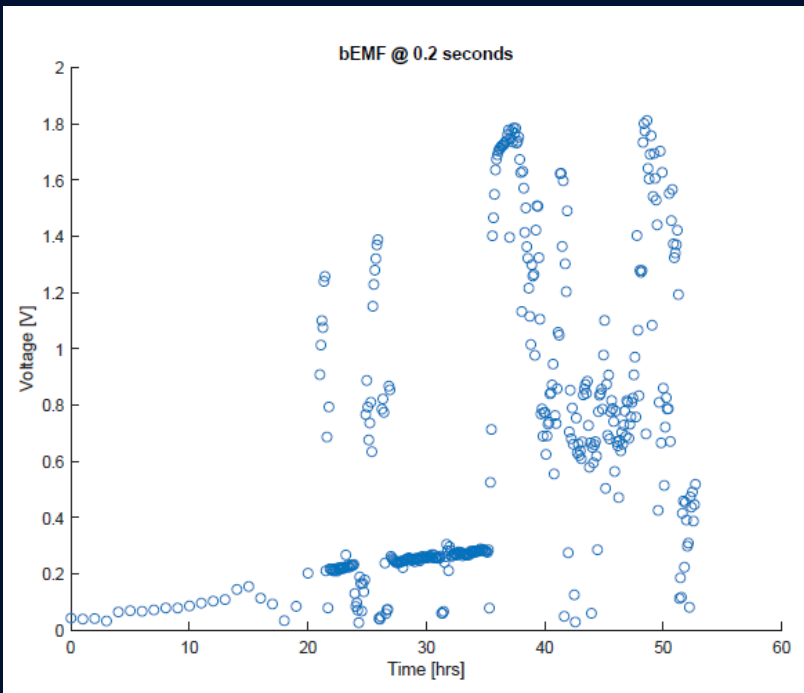

Run from this year


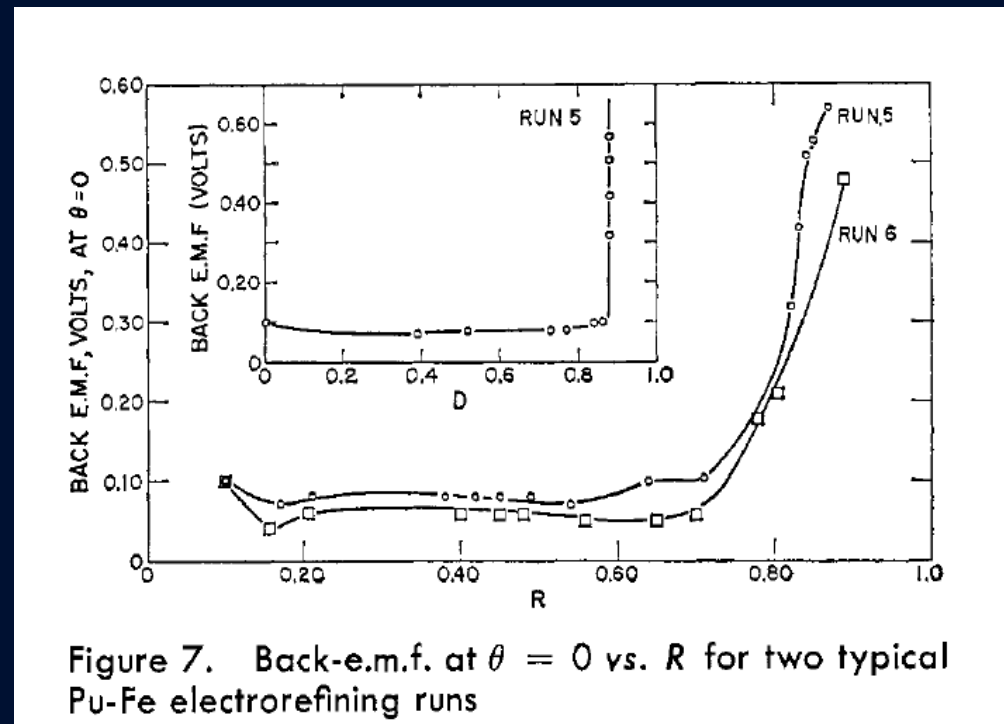


Figure 7. Back-e.m.f. at $\theta = 0$ vs. R for two typical Pu-Fe electrorefining runs


"Textbook" run from 1960s

Hypothesis #3

- Teflon piece that insulates electrode and holds in place is not long enough.
- As a run progresses, volatiles deposit on the bottom of the cell head where it is cooler.
- Buildup in the seal gland electrically shorts the anode to the cell head.

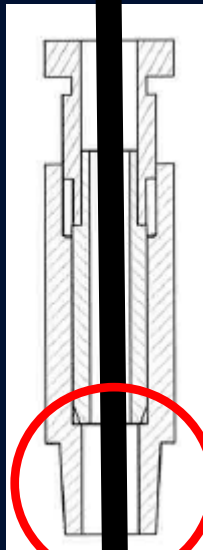


Re-design

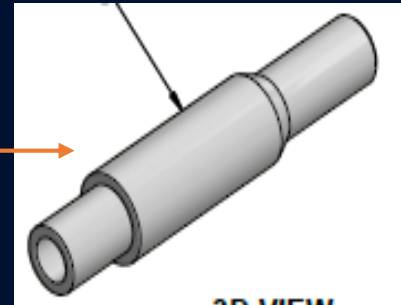

Build-up and short location

Solving the low yield problem

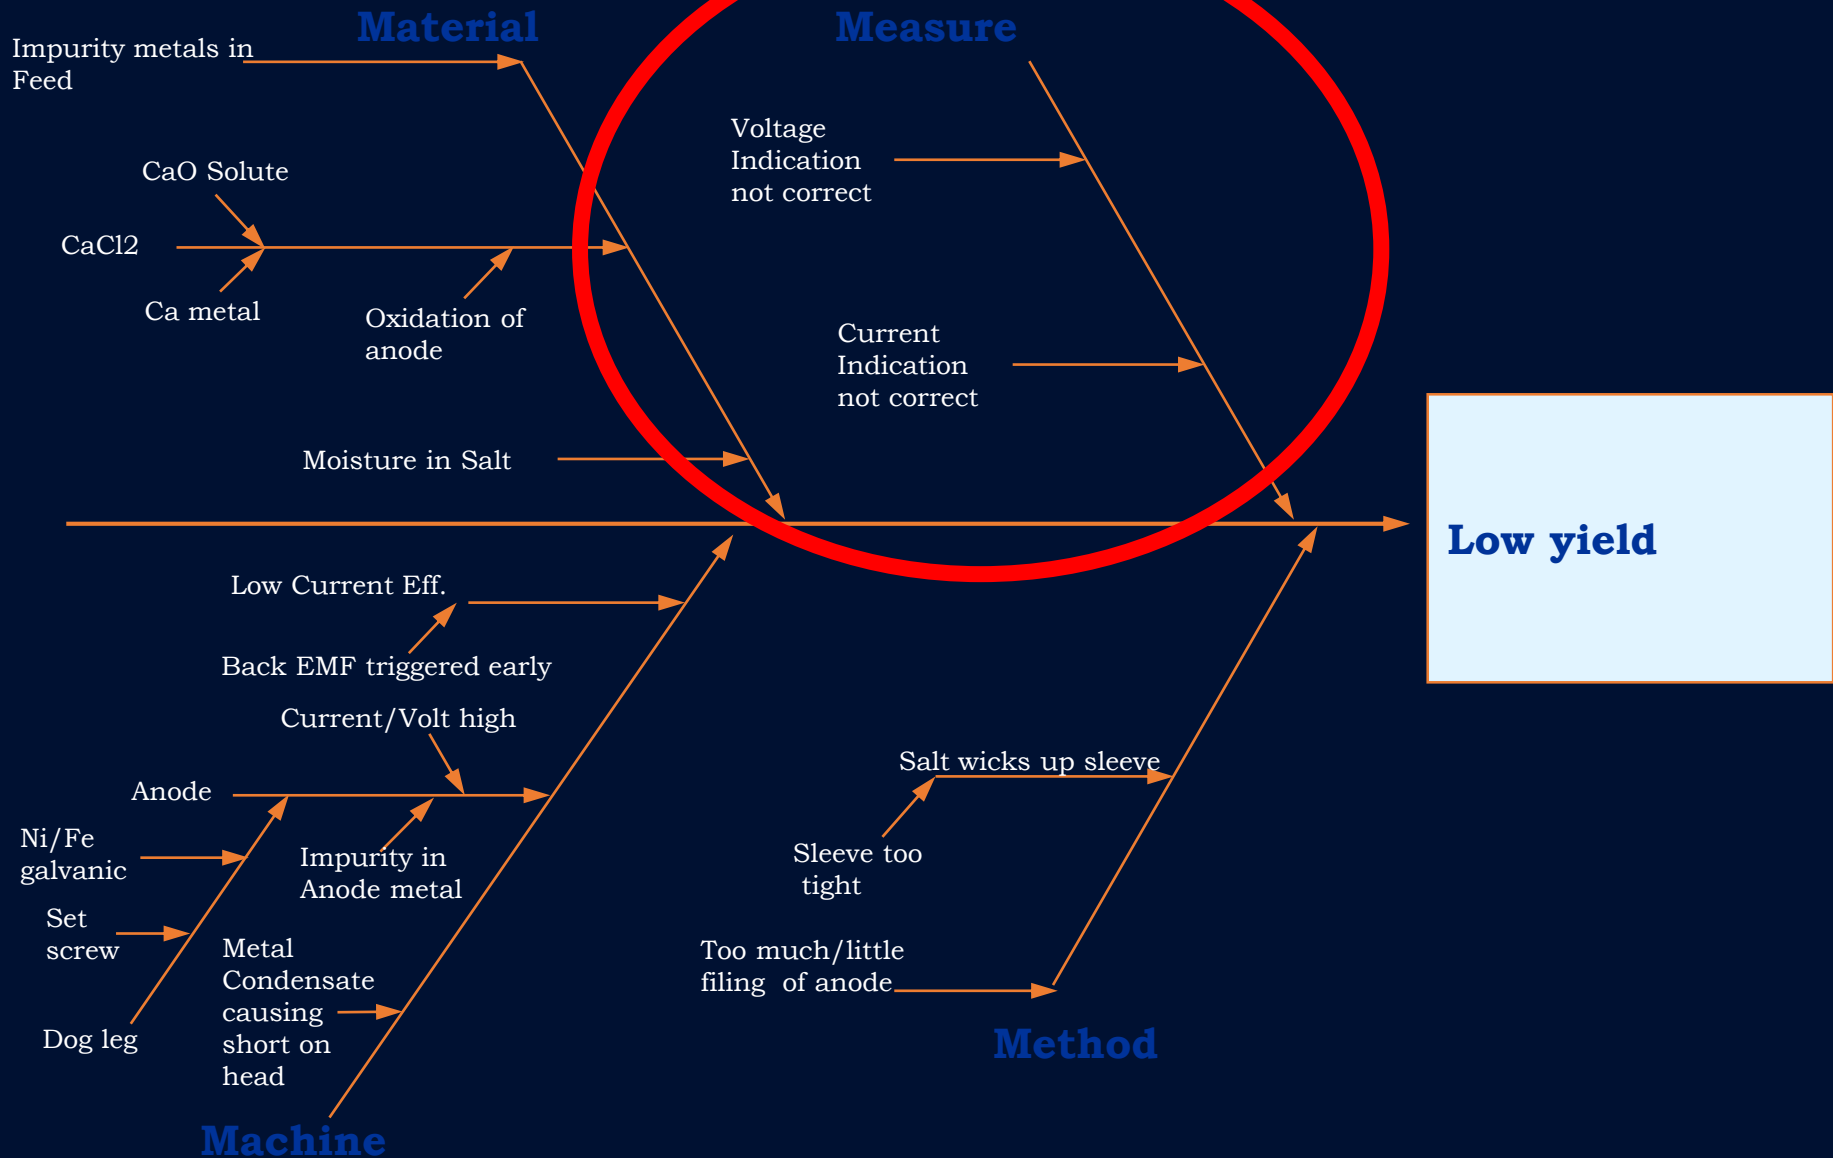

Measure


Problem

- Voltage Indication incorrect
- Current indication incorrect

Test

- Into multi-meter with alligator clips
- Use a current clamp on top of box

Solving the low yield problem

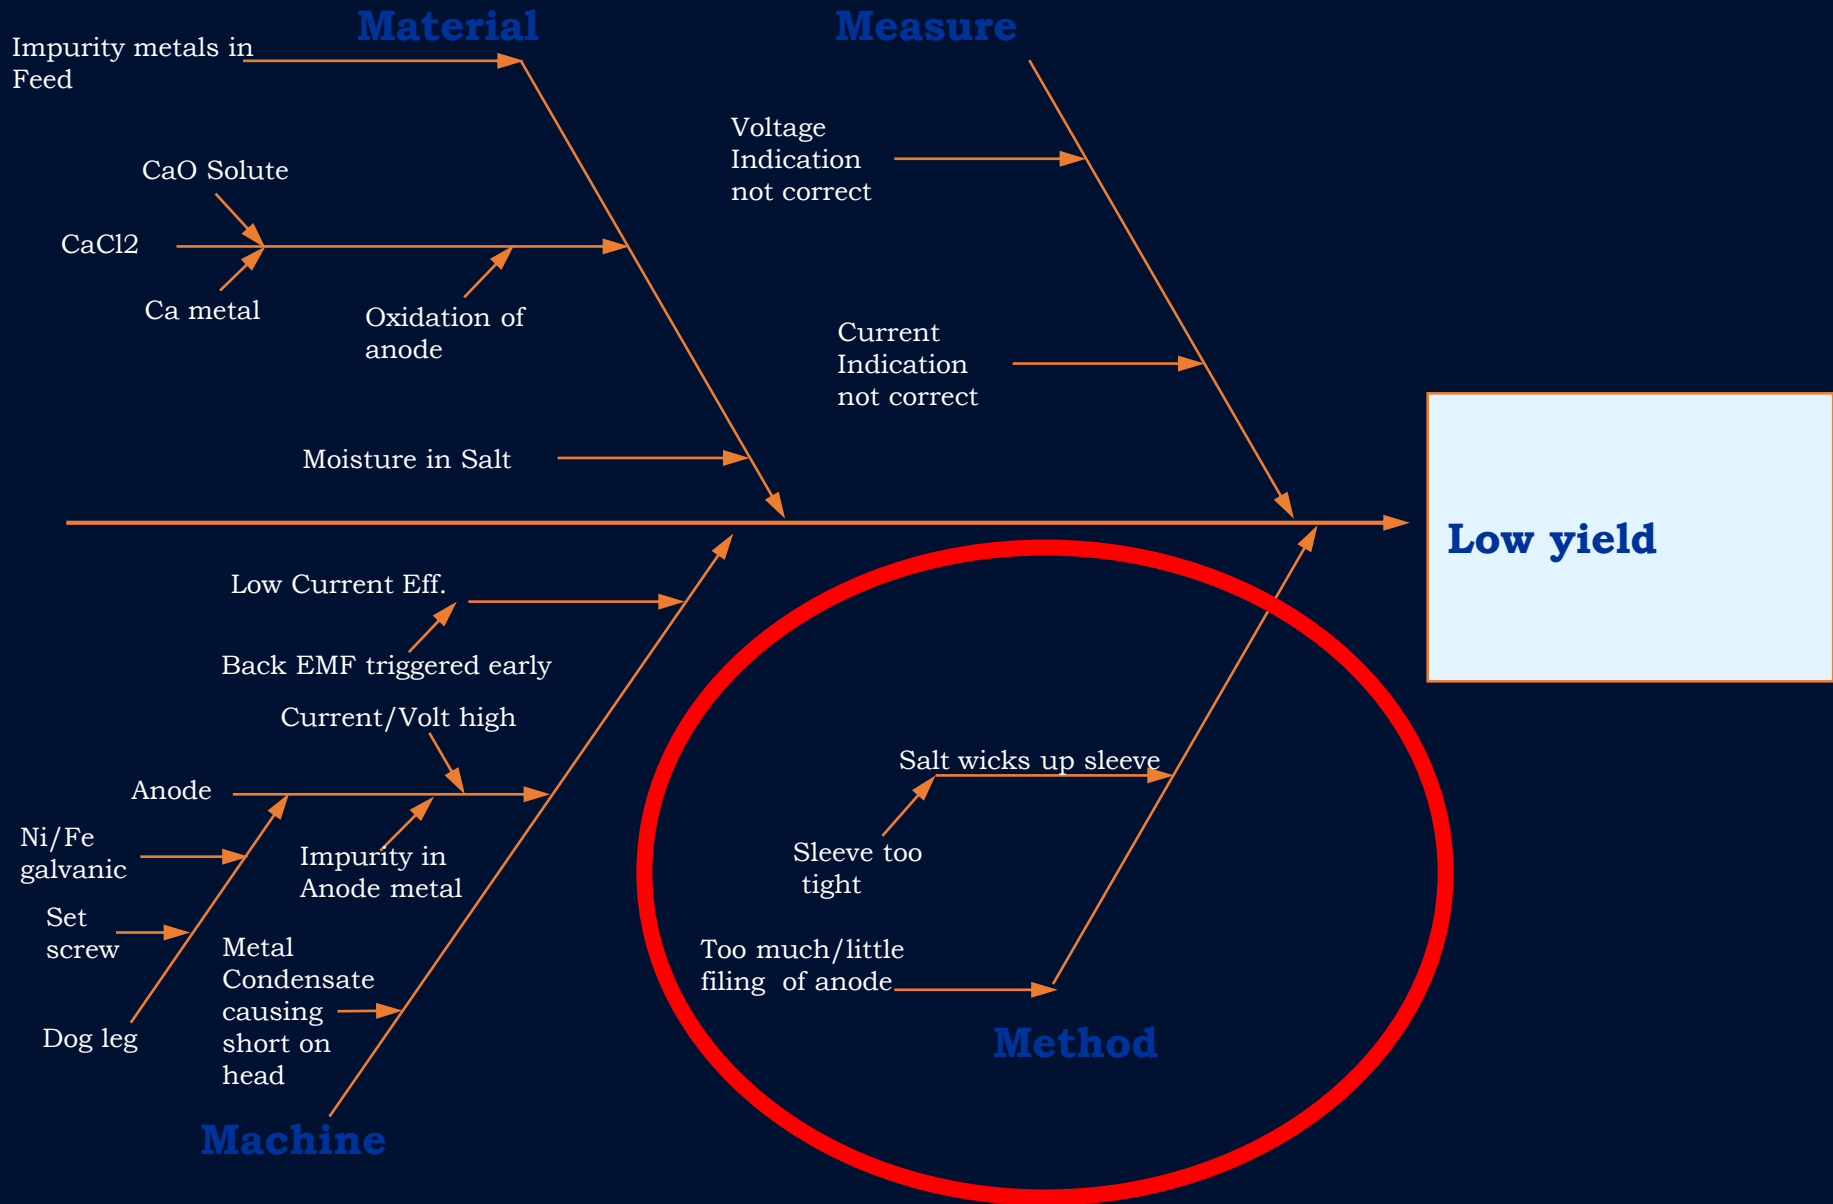

Method

Problem

- Sleeve is overtightened and salt wicks up sleeve and starts making contact with dog leg.


Test

- Have a slot gauge to ensure spacing

Solving the low yield problem



Solving the low yield problem ‘

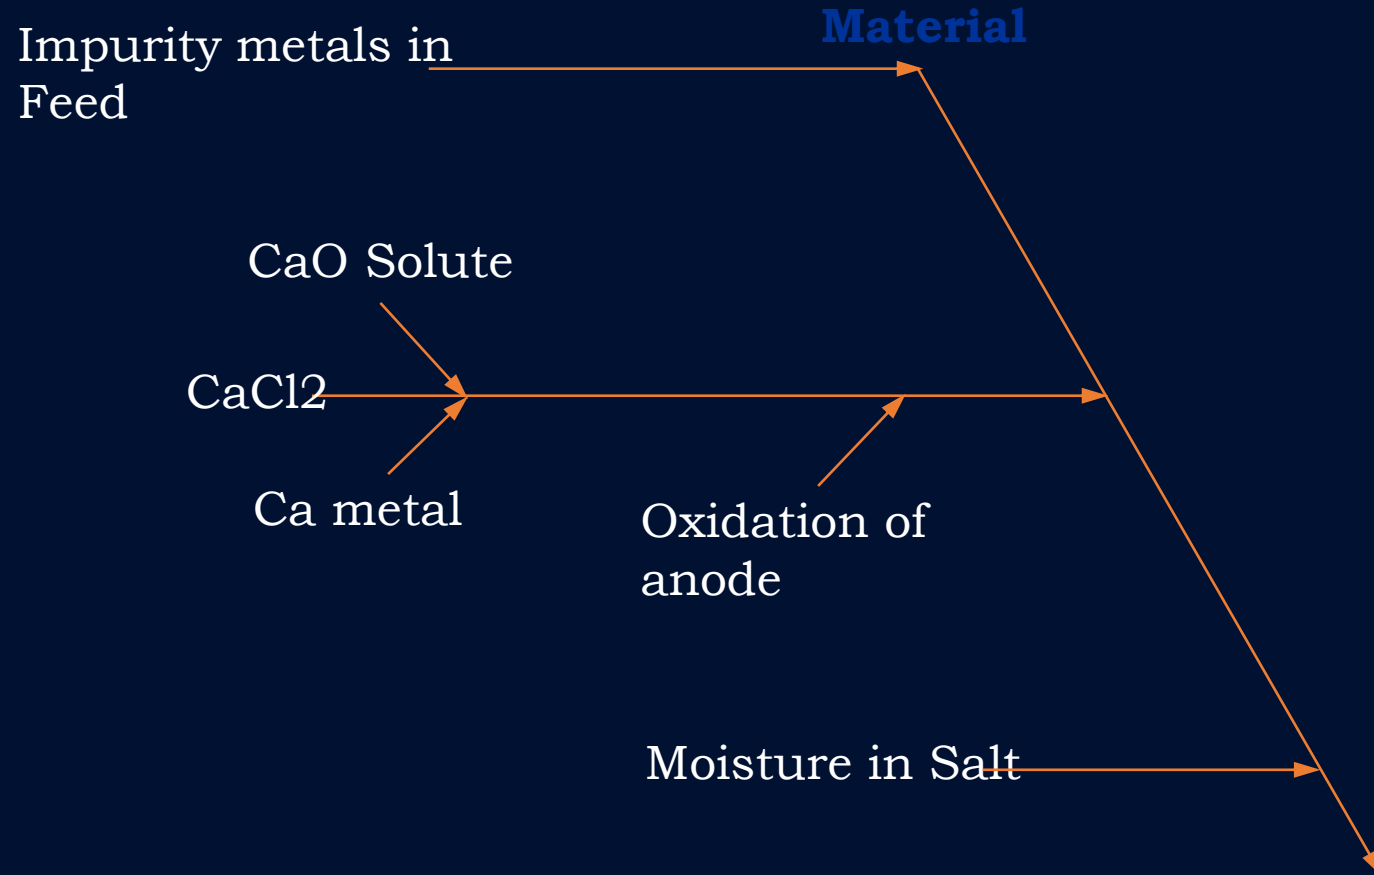

Material

Problem

- All issues related to CaCl_2
- Impurity in feed
- Moisture in salt

Test

- temporarily stop using CaCl_2
- Regression models chemistry data
- Use new MgCl Salt with eutectic